



3. KEEP VALVE PACKING NUT TIGHT—

After the Lantern has been in use for a period of time the Valve Stem Packing may shrink, allowing a slight leak at that point. To eliminate leak, tighten Pack Nut a few turns to hold Packing in firm contact with Valve Stem. Note: If Pack Nut is drawn up too tightly Valve will not turn. Back off slightly. Replace Packing if leak is not stopped by tightening Pack Nut.

4. TO CHANGE GENERATOR—

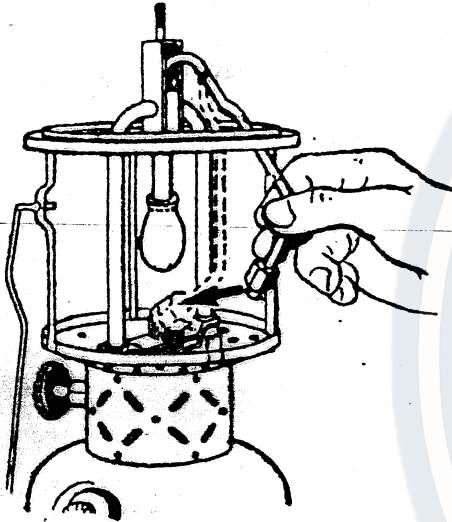

To clean Generator Tip remove Generator Lock Nut and Generator Tube. A cleaning needle is attached to the Wrench which fits into the bottom of the Globe Cage held in place by a Spring. Push Needle through hole in Generator Tip to clean.

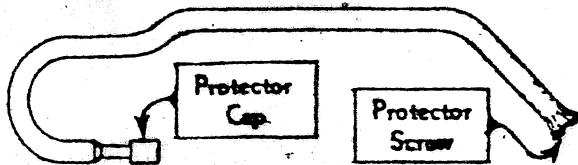

IMPORTANT! Before replacing with new Generator, be sure the protecting cap (on discharge end of Generator) is removed; also remove the protecting screw at the bottom end of Generator.

Care should be exercised in starting the Generator Lock Nut to eliminate the possibility of cross threading. Tighten the Lock Nut as much as possible with fingers; then tighten firmly with Wrench. **Important!** Hold Generator in correct position while tightening Lock Nut to avoid twisting the Generator.

ORDER BY PHONE OR MAIL, WITH check or money order in the shop postage prepaid. Please allow 3 to 4 weeks for mail order service. No Sales Tax for out of state orders. All Kansas orders include 3% Sales Tax.

6260-174-3874

DIRECTIONS

for

Operating

(Pkg of 2)

INSTANT-LIGHTING LANTERN


No. 252A

ORDER BY NUMBER	NAME OF PART	QUARTER-MASTER STOCK NUMBER	Retail Price
21A1001	(21A) Mantle	31-M-500	\$.74
118B1361	Gasket (Filler Plug)	31-G-40	.42
118B6201	Packing (Valve Stem)	33-P-3900	.36
216-5091	Leather (Pump)	31-L-750	.60
252-524	Air Stem		1.32
252-5221	Valve (Check)		1.68
220B4231	Bail		1.68
220B498	Frame & Bail	31-F-105	No Stock
220B619	Disc. (Direction)		.30
220D6571	Valve Ass'y (Fuel)	31-V-150	6.42
479-131	Plug (Filler)	31-C-63	No Stock
252B2101	Nut (Lamb)	31-N-700	.42
252B2891	Generator	31-G-103	\$ 3.48 (Obsolete Military Lantern)
203-441	Ball (Nut)		.36 (Single Mantle)
252-485	Ventilator		No Stock
252G5201	Plunger Ass'y (Pump)	31-P-1425	3.36
252-6531	Stem (Valve)	31-S-175	No Stock
252A9051	Pricker	31-P-1475	No Stock
252B95B	Wrench with Pricker	31-W-500	No Stock
407-649H	Wheel (Valve)	31-K-750	.6
690-048	Pyrex	31-G-365	3.30

1/1/80 Only part numbers with current price listings available. New typed in part numbers are substitutes.

Some models of the Military Lantern used quadrant section globes, these are no longer available, the 690-048 globe can be used on these models by removing the inner frame that held the sections.

www.OldColemanParts.com

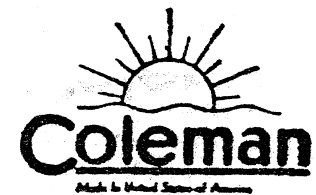

The Coleman Company, Inc.

General Office and Factory: WICHITA 1, KANSAS, U. S. A.
 Canadian Office and Factory: Toronto, Canada
 Sales Offices: Philadelphia 3; San Francisco 3; Los Angeles 1;
 Honolulu, Hawaii